





CHEMICALS: TRAFFIC WAX LIQUID

EQUIPMENT:

- | | |
|---|-------------------------------|
| Personal Protective Equipment (goggles, gloves) | Dust Pan & Broom |
| Tape | Basin brushes or tan pads |
| Wet Floor Signs | Steel wool pad |
| Clean Mop Bucket with Wringer | Dust Mop |
| Clean lambs wool applicator or Mop with handle | Single Disk low speed machine |

PROCEDURES:

| STEPS | | KEY POINTS |
|---|---|--|
| <ol style="list-style-type: none"> Assemble equipment. Remove any free-standing objects from the floor. |  | <ol style="list-style-type: none"> See above. Place "Caution-Wet Floor" signs at the end of each area. |
| <ol style="list-style-type: none"> Sweep using a fine hair broom entire floor and remove all dry soil & dust. Ensure adequate ventilation is present. Remove all sources of ignition. |  | <ol style="list-style-type: none"> Work toward ends of area, pick up with dust pan and broom. Open windows or mechanically ventilate area. Do not allow smoking in the area. |
| <p>Maintenance</p> <ol style="list-style-type: none"> For spillage's such as alcohol and soft drinks. Prepare a solution of Forward DC 1:40 in cold water and damp mop affected area. |  | <ol style="list-style-type: none"> Damp mopping will remove some or all of the wax so a new coat will be required. This is first seen as the wax going white. |
| <p>Recoating</p> <ol style="list-style-type: none"> Pour finish into clean dry bucket reserved for finish application. If using Paste, work direct from container. Dip clean poly cotton mop head into the bucket. Pull out using a light pressure on the wringer. |  | <ol style="list-style-type: none"> Avoid contamination of other water based coatings. During cold weather the bucket may need to be warmed. Wring until mop no longer drips. Do not apply excessive pressure as the mop will be too dry. |

3. Apply coat to worn areas only.
4. Allow the coat to dry.



3. The first coat is only to repair any damage that has occurred to floor.
4. Do not force dry the surface.

Burnishing

1. Using a bassine brush or tan pad on the single disk machine, buff floor to desired gloss.



1. This treatment will remove scuff marks and scratches

Stripping or Heavy Clean

1. Dilute 1 part Wax to 3 parts mineral turps.
2. Spread solution liberally over the floor in workable sections.



1. When the wax has built up or buffing not giving the desired result.
2. Caution flammability hazard. Ventilate area.

3. Scrub with a polishing machine and a steelwool pad.
4. Pick up slurry with mop and rinse floor with mineral turps.



3. The scrubbing will remove all old wax to leave a fresh clean floor.
4. Wax left on floor will buff but colour variations may occur.

5. Apply two coats of wax allowing coats to dry. If wax coat is uneven, dilute wax 1:1 with turps.
6. Burnish floor with brush or tan pad.



5. On porous floors more coats may be required.
6. Gloss will build with more buffing.

Clean Up

1. Clean all equipment paying particular attention to mophead and bucket. Return to its appropriate area.
2. Replace all moved furniture.



1. Equipment in good clean working order improves the quality of the result. Remove wet floor signs.
2. Return of moved items leaves job complete.